

JOHN TAYLOR & Co.

PHONE: 2241 (2 LINES)  
TELEGRAMS: "BELLS, LOUGHBOROUGH"

CHURCH BELLS  
PEALS-CHIMES  
CARILLONS  
CLOCK BELLS

RESTORING OLD OAK BELL FRAMES A SPECIALITY

THE BELL FOUNDRY,

LOUGHBOROUGH,

ENG.

22 November 1955.

M. Crook, Esq.,  
6, Manningham Road,  
Deane,  
Bolton,  
Lancs.


Dear Sir,

Deane Church.

In accordance with our previous correspondence our Mr. Fidler visited the tower of the above Church on Wednesday, the 16th instant, when he went over all the nuts and bolts of the bellfittings and bellframe and left them all properly tightened up. The cause of the second bell becoming jammed was the result of the second runner board being loose and fouling the stay - this, however, was remedied. The lubricators of the joint pins on the treble and second clappers were missing so new ones were fitted.

Mr. Fidler reports that he explained maintenance details to the ringer who was present during part of the inspection and we hope that such little as is necessary in this respect will be carried out from time to time and so keep the peal in first-class order. Mr. Fidler tried each bell and found that all of them handled very nicely.

Yours faithfully,

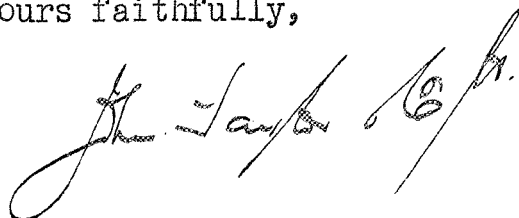

CH/JS.